

RKE DISCONNECT AFTER TPMS RELEARN



Vehicles: Most Ford, Lincoln, and Mercury models.

Problem: After installing and registering new sensors, Remote Keyless Entry (RKE) fobs stop working.

Explanation: The processes for entering key fob training mode and manual TPMS relearn mode are very similar. A slight alteration in the manual TPMS relearn process can inadvertently enter the vehicle's key fob retraining mode. Once this happens, all previously stored key fobs are erased.

For example, on a 2013 Ford Focus:



- To enter key fob training mode, cycle the ignition 4 times.



- To enter TPMS relearn mode, cycle ignition 3 times, tap brake, then cycle ignition 3 more times.

Solution: Follow the RKE retraining instructions to train the key fobs back to the vehicle. Contact Dill for instructions.

Prevention: Always follow relearn procedures step by step!